


Owner's Manual



Autoranging Multimeter

Model No. 82008

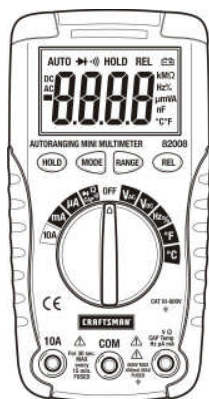

CAUTION: Read, understand and follow Safety Rules and Operating Instructions in this manual before using this product.

- Safety
- Operation
- Maintenance
- Español

© Sears, Roebuck and Co., Hoffman Estates, IL 60179 U.S.A.
www.craftsman.com 061110

TABLE OF CONTENTS

Warranty	Page 3
Safety Instructions	4
Safety Symbols	5
Control and Jacks	6
Symbols and Annunciators	6
Specifications	7
Battery Installation	11
Operating Instructions	12
DC Voltage Measurements	12
AC Voltage Measurements	13
DC Current Measurements	14
AC Current Measurements	15
Resistance Measurements	16
Continuity Check	17
Diode Test	17
Capacitance Measurements	18
Frequency Measurements	18
Temperature Measurements	19
Auto/Manual ranging	20
Relative Mode	20
Data Hold	21
Auto Power OFF	21
Low Battery Indication	21
Maintenance	22
Battery Replacement	22
Fuse Replacement	23
Troubleshooting	23
Service and Parts	23

ONE YEAR FULL WARRANTY

ONE YEAR Full WARRANTY ON CRAFTSMAN MULTIMETER
If this CRAFTSMAN MULTIMETER fails to give complete satisfaction within one year from the date of purchase, RETURN IT TO THE NEAREST SEARS STORE OR OTHER CRAFTSMAN OUTLET IN THE UNITED STATES, and Sears will replace it, free of charge.
If this CRAFTSMAN MULTIMETER is used for commercial or rental purposes, this warranty applies for 90 days from the date of purchase.
This warranty gives you specific legal rights, and you may also have other rights which vary from state to state
Sears, Roebuck and Co., Dept. 817WA, Hoffman Estates, IL 60179

**For Customer Assistance Call 9am - 5pm (ET)
Monday through Friday 1-888-326-1006**

WARNING: USE EXTREME CAUTION IN THE USE OF THIS DEVICE. Improper use of this device can result in injury or death. Follow all safeguards suggested in this manual in addition to the normal safety precautions used in working with electrical circuits. DO NOT service this device if you are not qualified to do so.

SAFETY INSTRUCTIONS

This meter has been designed for safe use, but must be operated with caution. The rules listed below must be carefully followed for safe operation.

1. **NEVER** apply voltage or current to the meter that exceeds the specified maximum:

Input Protection Limits	
Function	Maximum Input
V DC or V AC	600VDC/AC
mA AC/DC	400mA AC/DC
A AC/DC	10A AC/DC (20A for 30 sec max every 15 min)
Frequency, Resistance, Capacitance, Diode Test, Continuity, Temperature	250VDC/AC

2. **USE EXTREME CAUTION** when working with high voltages
3. **DO NOT** measure voltage if the voltage on the "COM" input jack exceeds 600V above earth ground
4. **DO NOT** measure current of circuits whose voltage is greater than 600V above earth ground
5. **NEVER** connect the meter leads across a voltage source while the function switch is in the resistance or diode mode. Doing so can damage the meter
6. **ALWAYS** turn off the power and disconnect the test leads before opening the cover to replace the fuse or battery
7. **NEVER** operate the meter unless the back cover is in place and fastened securely

SAFETY SYMBOLS



This symbol adjacent to another symbol, terminal or operating device indicates that the operator must refer to an explanation in the Operating Instructions to avoid personal injury or damage to the meter.

WARNING

This **WARNING** symbol indicates a potentially hazardous situation, which if not avoided, could result in death or serious injury.

CAUTION

This **CAUTION** symbol indicates a potentially hazardous situation, which if not avoided, may result damage to the product.



This symbol advises the user that the terminal(s) so marked must not be connected to a circuit point at which the voltage with respect to earth ground exceeds (in this case) 600 VAC or VDC.




This symbol adjacent to one or more terminals identifies them as being associated with ranges that may, in normal use, be subjected to particularly hazardous voltages. For maximum safety, the meter and its test leads should not be handled when these terminals are energized.



This symbol indicates that a device is protected throughout by double insulation or reinforced insulation.


CONTROLS AND JACKS

1. 4,000 count LCD display
2. MODE button
3. HOLD button
4. Function switch
5. COM input jack
6. 10A input jack
7. V, Ω , CAP, Temp, Hz, μ A and mA input jack
8. REL button
9. RANGE button
10. Battery compartment (rear)

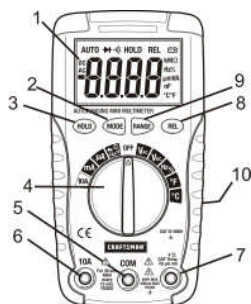

SYMBOLS AND ANNUNCIATORS

•)))	Continuity
	Diode test
	Low Battery
n	nano (10^{-9}) (capacitance)
μ	micro (10^{-6}) (amps)
m	milli (10^{-3}) (volts, amps)
A	Amps
k	kilo (10^3) (ohms)
F	Farads (capacitance)
M	mega (10^6) (ohms)
Ω	Ohms
Hz	Hertz (frequency)
%	Percent (duty ratio)
AC	Alternating current
DC	Direct current
$^{\circ}$ F	Degrees Fahrenheit

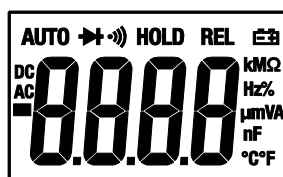


V	Volts
REL	Relative
AUTO	Autoranging
HOLD	Display hold
$^{\circ}$ C	Degrees Centigrade

SPECIFICATIONS

Function	Range	Resolution	Accuracy
DC Voltage (V DC)	4V	0.001V	±(1.2% reading + 2 digits)
	40V	0.01V	
	400V	0.1V	
	600V	1V	±(1.5% reading + 2 digits)
AC Voltage (V AC) (50 / 60Hz)	400mV*	0.1mV	±(1.5% reading + 15 digits)
	4V	0.001mV	±(1.2% reading + 3 digits)
	40V	0.01V	±(1.5% reading + 3 digits)
	400V	0.1V	
	600V	1V	±(2.0% reading + 4 digits)
	*400mV range is not autoranging		
DC Current (A DC)	400µA	0.1µA	±(1.0% reading + 3 digits)
	4000µA	1µA	±(1.5% reading + 3 digits)
	40mA	0.01mA	
	400mA	0.1mA	
	10A	0.01A	±(2.5% reading + 5 digits)
AC Current (A AC)	400µA	0.1µA	±(1.5% reading + 5 digits)
	4000µA	1µA	±(1.8% reading + 5 digits)
	40mA	0.01mA	
	400mA	0.1mA	
	10A	0.01A	±(3.0% reading + 7 digits)

Resistance	400Ω	0.1Ω	±(1.2% reading + 4 digits)
	4kΩ	1Ω	±(1.0% reading + 2 digits)
	40kΩ	0.01kΩ	±(1.2% reading + 2 digits)
	400kΩ	0.1kΩ	
	4MΩ	0.001MΩ	
	40MΩ	0.01MΩ	±(2.0% reading + 3 digits)
Capacitance	40nF	0.01nF	±(5.0% reading + 30 digits)
	400nF	0.1nF	±(3.0% reading + 5 digits)
	4μF	0.001μF	
	40μF	0.01μF	
	100μF	0.1μF	±(5.0% reading + 5 digits)
Duty Cycle	0.1 to 99.9%	0.1%	±(1.2% reading + 2 digits)
	pulse width range: 100μs - 100ms (Frequency: 5Hz to 150kHz)		
Temp (type-K)	-4 to 1400°F	1°F	±(3.0% reading + 9°F/5°C) (probe accuracy not included)
	-20 to 750°C	1°C	
Frequency	5.000Hz	0.001Hz	±(1.5% reading + 5 digits)
	50.00Hz	0.01Hz	
	500.0Hz	0.1Hz	
	5.000kHz	0.001kHz	±(1.2% reading + 3 digits)
	50.00kHz	0.01kHz	
	500.0kHz	0.1kHz	
	5.000MHz	0.001MHz	±(1.5% reading + 4 digits)
	Sensitivity: >0.5V rms min. [1MHz; >3V rms > 1MHz		

NOTE: Accuracy is stated at 65°F to 83°F (18°C to 28°C) and less than 75% RH.

Diode Test	Test current of 0.3mA typical, open circuit voltage 1.5V DC typical
Continuity Check	Audible signal will sound if the resistance is less than 150Ω (approx.), test current <0.3mA
Temperature Sensor	Requires type K thermocouple
Input Impedance	7.8MΩ
AC Response	Average responding
ACV Bandwidth	50Hz to 400Hz
Display	4,000 count liquid crystal
Overrange indication	“OL” is displayed
Auto Power Off	30 minutes (approximately)
Polarity	Automatic (no indication for positive); Minus (-) sign for negative
Measurement Rate	2 times per second, nominal
Low Battery Indication	“  ” is displayed if battery voltage drops below operating voltage
Battery	Two AAA batteries
Fuses	mA, μA ranges; 0.5A/250V ceramic fast blow A range; 10A/250V ceramic fast blow
Operating Temperature	41°F to 104°F (5°C to 40°C)
Storage Temperature	-4°F to 140°F (-20°C to 60°C)
Operating Humidity	Max 80% up to 87°F (31°C) decreasing linearly to 50% at 104°F (40°C)
Storage Humidity	<80%
Operating Altitude	7000ft. (2000meters) maximum.
Weight	0.5lb (225g) (includes holster).
Size	5.31” x 2.67” x 1.7” (135 x 68 x 43mm)

Safety	This meter is intended for indoor use and protected, against the users, by double insulation per EN61010-1 and IEC61010-1 2nd Edition (2001) to CAT II 1000V & CAT III 600V; Pollution Degree 2. The meter also meets UL 61010-1, Second Edition (2004), CAN/CSA C22.2 No. 61010-1, Second Edition (2004), and UL 61010B-2-031, First Edition (2003)
Approvals	UL, ETL

BATTERY INSTALLATION

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery cover.

1. Disconnect the test leads from the meter.
2. Remove the 2 Phillips head screws located on the back of the instrument and remove the battery cover.
3. Replace the 2 AAA batteries.
4. Secure the fuse/battery compartment cover.
5. Dispose of the old battery as required by local regulations.

WARNING: To avoid electric shock, do not operate the meter until the battery cover is in place and fastened securely.

NOTE: If your meter does not work properly, check the fuses and batteries to make sure that they are still good and that they are properly inserted.

OPERATING INSTRUCTIONS

WARNING: Risk of electrocution. High-voltage circuits, both AC and DC, are very dangerous and should be measured with great care.

1. ALWAYS turn the function switch to the OFF position when the meter is not in use.
2. If “OL” appears in the display during a measurement, the value exceeds the range you have selected. Change to a higher range.

NOTE: On some low AC and DC voltage ranges, with the test leads not connected to a device, the display may show a random, changing reading. This is normal and is caused by the high-input sensitivity. The reading will stabilize and give a proper measurement when connected to a circuit.

DC VOLTAGE MEASUREMENTS

CAUTION: Do not measure DC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

1. Set the function switch to the **VDC** position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **V** jack.
3. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
4. Read the voltage in the display.



AC VOLTAGE (Frequency, Duty Cycle) MEASUREMENTS

AC VOLTAGE: The probe tips may not be long enough to contact the live parts inside some 240V outlets for appliances because the contacts are recessed deep in the outlets. As a result, the reading may show 0 volts when the outlet actually has voltage on it.

WARNING: To avoid electric shock, make sure the probe tips are touching the metal contacts inside the outlet before assuming no voltage is present

CAUTION: Do not measure AC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


1. Set the function switch to the **VAC** position.
2. Insert the black test lead banana plug into the negative **COM** jack.
Insert red test lead banana plug into the positive **V** jack.
3. Touch the black test probe tip to the neutral side of the circuit.
Touch the red test probe tip to the "hot" side of the circuit.
4. Read the voltage in the display.
5. Press the **MODE** button to indicate "**Hz**".
6. Read the frequency in the display.
7. Press the **MODE** button again to indicate "%".
8. Read the % of duty cycle in the display.



DC CURRENT MEASUREMENTS

CAUTION: Do not make current measurements on the **20A** scale for longer than **30** seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


1. Insert the black test lead banana plug into the negative **COM** jack.
2. For current measurements up to 4000 μ A DC:
Set the function switch to the **μ A** position and insert the red test lead banana plug into the **μ A** jack.
3. For current measurements up to 400mA DC:
Set the function switch to the **mA** position and insert the red test lead banana plug into the **mA** jack.
4. For current measurements up to 10A DC:
Set the function switch to the **10A** position and insert the red test lead banana plug into the **10A** jack.
5. Press the **MODE** button to indicate "**DC**" on the display.
6. Remove power from the circuit under test, then open the circuit at the point where you wish to measure current.
7. Touch the black test probe tip to the negative side of the circuit.
Touch the red test probe tip to the positive side of the circuit.
8. Apply power to the circuit.
9. Read the current in the display.

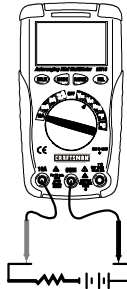

AC CURRENT MEASUREMENTS

CAUTION: Do not make 20A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.

1. Insert the black test lead banana plug into the negative **COM** jack.
2. For current measurements up to 4000 μ A AC;
Set the function switch to the **μ A** position and insert the red test lead banana plug into the **μ A** jack.
3. For current measurements up to 400mA AC;
Set the function switch to the **mA** position and insert the red test lead banana plug into the **mA** jack.
4. For current measurements up to 10A AC:
Set the function switch to the **10A** position and insert the red test lead banana plug into the **10A** jack.
5. Press the **MODE** button to indicate "**AC**" on the display.
6. Remove power from the circuit under test, then open the circuit at the point where you wish to measure current.
7. Touch the black test probe tip to the negative side of the circuit.
Touch the red test probe tip to the positive side of the circuit.
8. Apply power to the circuit.
9. Read the current in the display.

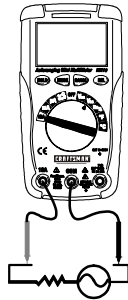

RESISTANCE MEASUREMENTS

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.

1. Set the function switch to the Ω position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive Ω jack.
3. Press the **MODE** button to indicate " Ω " on the display.
4. Touch the test probe tips across the circuit or part under test.
5. Read the resistance in the display.



CONTINUITY CHECK

WARNING: To avoid electric shock, never measure continuity on circuits or wires that have voltage on them.

1. Set the function switch to the \rightarrow position.
2. Insert the black lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive Ω jack.
3. Press the **MODE** button to indicate \rightarrow "□" and " Ω " on the display
4. Touch the test probe tips to the circuit or wire you wish to check.
5. If the resistance is less than approximately 150Ω , the audible signal will sound. If the circuit is open, the display will indicate "**OL**".



DIODE TEST

1. Set the function switch to the \rightarrow position.
2. Insert the black test lead banana plug into the negative **COM** jack and the red test lead banana plug into the positive **V** jack.
3. Press the **MODE** button to indicate \rightarrow and **V** □□□□ on the display.
4. Touch the test probes to the diode under test. Forward voltage will typically indicate 0.400 to 0.700V. Reverse voltage will indicate "**OL**". Shorted devices will indicate near 0V and an open device will indicate "**OL**" in both polarities.



CAPACITANCE MEASUREMENTS

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any capacitance measurements. Remove the batteries and unplug the line cords.

1. Set the rotary function switch to the **CAP** position.
2. Insert the black test lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **CAP** jack.
3. Press the **MODE** button to indicate “**nF**” on the display.
4. Touch the test leads to the capacitor to be tested.
5. Read the capacitance value in the display



 
FREQUENCY/DUTY CYCLE MEASUREMENTS

1. Set the rotary function switch to the “**Hz %**” position.
2. Press the **MODE** button to indicate “**Hz**” in the display.
3. Insert the black lead banana plug into the negative **COM** jack. Insert the red test lead banana plug into the positive **Hz** jack.
4. Touch the test probe tips to the circuit under test.
5. Read the frequency on the display.
6. Press the **MODE** button again to indicate “**%**” on the display.
7. Read the % of duty cycle on the display.



TEMPERATURE MEASUREMENTS

1. Set the function switch to the °F or °C position.
2. Insert the Temperature Probe into the input jacks, making sure to observe the correct polarity.
3. Touch the Temperature Probe head to the part whose temperature you wish to measure. Keep the probe touching the part under test until the reading stabilizes (about 30 seconds).
4. Read the temperature in the display.



Note: The temperature probe is fitted with a type K mini connector. A mini connector to banana connector adaptor is supplied for connection to the input banana jacks.

Note: The supplied thermocouple is rated for 482°F (250°C). For higher temperatures you can purchase a high temperature thermocouple from www.craftsman.com.

AUTORANGING/MANUAL RANGE SELECTION

When the meter is first turned on, it automatically goes into Autoranging. This automatically selects the best range for the measurements being made and is generally the best mode for most measurements. For measurement situations requiring that a range be manually selected, perform the following:

1. Press the **RANGE** button. The "Auto" display indicator will turn off.
2. Press the **RANGE** key to step through the available ranges. Observe the decimal point and units displayed until the preferred range is located.
3. To exit the Manual Ranging mode and return to Autoranging, press and hold the **RANGE** key for 2 seconds.

Note: Manual ranging does not apply for the Capacitance and Frequency functions.

RELATIVE MODE

The relative measurement feature allows you to make measurements relative to a stored zero reference value. A reference voltage, current, etc. can be stored and measurements made in comparison to that value. The displayed value is the difference between the reference value and the measured value.

1. Perform the measurement as described in the operating instructions.
2. Press the **REL** button to store (zero) the reading in the display. The "REL" indicator will appear on the display.
3. The display will now indicate the difference between the stored value and the measured value.
4. Press the **REL** button to exit the relative mode.

Note: The Relative function does not operate in the Frequency function.


HOLD

The hold function freezes the reading in the display. Press the **HOLD** key momentarily to activate or to exit the **HOLD** function.

AUTO POWER OFF

The auto off feature will turn the meter off after 30 minutes.

LOW BATTERY INDICATION

The  icon will appear in the display when the battery voltage becomes low. Replace the battery when this appears.

MAINTENANCE

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the back cover or the battery cover.

WARNING: To avoid electric shock, do not operate your meter until the battery cover is in place and fastened securely.

This multimeter is designed to provide years of dependable service, if the following care instructions are performed:

1. **KEEP THE METER DRY.** If it gets wet, wipe it off.
2. **USE AND STORE THE METER IN NORMAL TEMPERATURES.** Temperature extremes can shorten the life of the electronic parts and distort or melt plastic parts.
3. **HANDLE THE METER GENTLY AND CAREFULLY.** Dropping it can damage the electronic parts or the case.
4. **KEEP THE METER CLEAN.** Wipe the case occasionally with a damp cloth. DO NOT use chemicals, cleaning solvents, or detergents.
5. **USE ONLY FRESH BATTERIES OF THE RECOMMENDED SIZE AND TYPE.** Remove old or weak batteries so they do not leak and damage the unit.
6. **IF THE METER IS TO BE STORED FOR A LONG PERIOD OF TIME,** the batteries should be removed to prevent damage to the unit.

BATTERY REPLACEMENT

1. Disconnect the test leads from the meter.
2. Remove the 2 Phillips head screws located on the back of the instrument and remove the battery cover.
3. Replace the 2 AAA batteries.
4. Secure the fuse/battery compartment cover.
5. Dispose of the old battery as required by local regulations.

FUSE REPLACEMENT

1. Disconnect the test leads from the meter.
2. Remove the 2 Phillips head screws located on the back of the instrument and remove the battery cover.
3. Gently remove the fuse(s) and install the new fuse(s) into the holder(s).
4. Always use fuses of the proper size and value (500mA/250V ceramic fast blow for the mA / μ A ranges, 10A/250V ceramic fast blow for the A range).
5. Secure the fuse/battery compartment cover.

WARNING: To avoid electric shock, do not operate your meter until the fuse cover is in place and fastened securely.

TROUBLESHOOTING

There may be times when your meter does not operate properly. Here are some common problems that you may have and some easy solutions to them.

Meter Does Not Operate:

1. Always read all the instructions in this manual before use.
2. Check to be sure the battery is properly installed.
3. Check to be sure the battery is good.
4. If the battery is good and the meter still doesn't operate, check to be sure that both ends of the fuse are properly installed.

If You Do Not Understand How the Meter Works:

Call our Customer Service Line **1-888-326-1006**.

SERVICE AND PARTS

Item Number	Description
82378	Set of black and red Test Leads
82008-D	Replacement battery cover
82008-CS	Rear cover screws
82377	Thermocouple probe

For replacement parts shipped directly to your home

Call 9 am – 5 pm Eastern Time, M - F

1-888-326-1006