


Owner's Manual

CRAFTSMAN

Mini Multimeter with Non-Contact Voltage Detector (NCV)

Model No.
82314

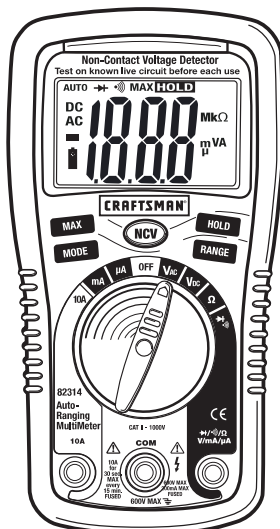

CAUTION: Read, understand and follow Safety Rules and Operating Instructions in this manual before using this product.

- Safety
- Operation
- Maintenance
- Español

© Sears, Roebuck and Co., Hoffman Estates, IL 60179 U.S.A.
www.craftsman.com 062006

TABLE OF CONTENTS

Warranty.....	3
Safety Instructions	4
Safety Symbols	5
Controls And Jacks.....	6
Symbols And Annunciators	7
Specifications	8
Battery Installation	12
Operating Instructions	13
Non-Contact AC Voltage Detector	14
AC Voltage Measurements.....	15
DC Voltage Measurements.....	16
AC / DC Current Measurements.....	17
Resistance Measurements	18
Continuity Check.....	19
Diode Test	20
Auto-Manual Range Selection.....	21
Max Mode.....	21
Auto Power Off.....	21
Maintenance	22
Low Battery Indication	22
Battery Replacement	23
Replacing The Fuses	24
Troubleshooting	245
Service And Parts	25

ONE YEAR FULL WARRANTY

ONE YEAR FULL WARRANTY ON CRAFTSMAN MULTIMETER

If this CRAFTSMAN Multimeter fails to give complete satisfaction within one year from the date of purchase, RETURN IT TO THE NEAREST SEARS STORE OR OTHER CRAFTSMAN OUTLET IN THE UNITED STATES, and Sears will replace it, free of charge.

This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

Sears, Roebuck and Co., Dept. 817WA, Hoffman Estates, IL 60179

For Customer Assistance Call 9am - 5pm (ET)

Monday through Friday 1-888-326-1006

WARNING: USE EXTREME CAUTION IN THE USE OF THIS DEVICE. Improper use of this device can result in injury or death. Follow all safeguards suggested in this manual in addition to the normal safety precautions used in working with electrical circuits. DO NOT service this device if you are not qualified to do so.

SAFETY INSTRUCTIONS

This meter has been designed for safe use, but must be operated with caution. The rules listed below must be carefully followed for safe operation.

1. **NEVER** apply voltage or current to the meter that exceeds the specified maximum:

Input Protection Limits	
Function	Maximum Input
V DC or V AC	600V AC and DC
mA AC/DC	200mA DC/AC
A AC/DC	10A DC/AC (for 30 seconds max. every 15 minutes)
Resistance, Diode Test, Continuity	250V DC/AC

2. **USE EXTREME CAUTION** when working with high voltages.
3. **DO NOT** measure voltage if the voltage on the "COM" input jack exceeds 600V above earth ground.
4. **NEVER** connect the meter leads across a voltage source while the function switch is in the current, resistance, or diode mode. Doing so can damage the meter.
5. **ALWAYS** discharge filter capacitors in power supplies and disconnect the power when making resistance or diode tests.
6. **ALWAYS** turn off power and disconnect test leads before opening the covers to replace the fuse or battery.
7. **NEVER** operate the meter unless the back cover and the battery and fuse covers are in place and fastened securely.
8. If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

SAFETY SYMBOLS



 
This symbol adjacent to another symbol, terminal or operating device indicates that the operator must refer to an explanation in the Operating Instructions to avoid personal injury or damage to the meter.

WARNING

This **WARNING** symbol indicates a potentially hazardous situation, which if not avoided, could result in death or serious injury.

CAUTION

This **CAUTION** symbol indicates a potentially hazardous situation, which if not avoided, may result damage to the product.



This symbol advises the user that the terminal(s) so marked must not be connected to a circuit point at which the voltage with respect to earth ground exceeds 600V.




This symbol adjacent to one or more terminals identifies them as being associated with ranges that may, in normal use, be subjected to particularly hazardous voltages. For maximum safety, the meter and its test leads should not be handled when these terminals are energized.



This symbol indicates that a device is protected throughout by double insulation or reinforced insulation.


CONTROLS AND JACKS

1. AC Voltage Detector Sensor
2. AC Voltage Detector indicator light
3. LCD display
4. MAX push-button
5. MODE button
6. Non-contact AC Voltage Detector test button
7. Rotary function dial
8. 10 ampere test lead jack
9. COM test lead jack
10. Test lead jack for voltage, milli-amp, micro-amp, & resistance functions
11. RANGE button
12. HOLD button
13. Protective rubber holster (must be removed to access the rear battery compartment)

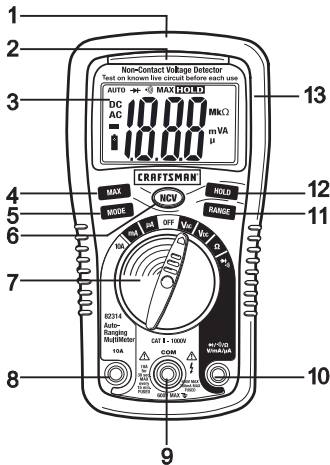

DISPLAY SYMBOLS AND ANNUNCIATORS

•)))	Continuity
▶	Diode test
🔋	Battery status
μ	micro (10^{-6}) (amps)
m amps)	milli (10^{-3}) (volts, amps)
k	kilo (10^3) (ohms)
M	mega (10^6) (ohms)
V	Volts
A	Amps
Ω	Ohms
AC	Alternating current
DC	Direct current
HOLD	Display hold
AUTO	Autoranging
MAX	Highest reading
C, F	Temperature units

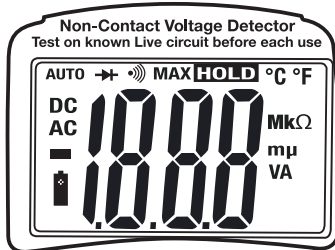

SPECIFICATIONS

Function	Range	Resolution	Accuracy
Non-contact AC Voltage detector	100 to 600V	Resolution & accuracy do not apply since the meter does not display the voltage in this mode. The lamp at the top of the meter's display flashes when voltage is sensed and an audible warning will sound.	
DC Voltage (V DC)	200mV	0.1mV	±(0.5% reading + 2 digits)
	2V	0.001V	±(1.0% reading + 2 digits)
	20V	0.01V	
	200V	0.1V	
	600V	1V	±(1.5% reading + 2 digits)
AC Voltage (V AC) (50/60Hz)	200mV	0.1mV	±(1.0% reading + 30 digits)
	2V	0.001mV	±(1.5% reading + 3 digits)
	20V	0.01V	
	200V	0.1V	
	600V	1V	±(2.0% reading + 4 digits)
DC Current (A DC)	200μA	0.1μA	±(1.0% reading + 3 digits)
	2000μA	1μA	±(1.5% reading + 3 digits)
	20mA	0.01mA	
	200mA	0.1mA	
	2A	0.001A	±(2.5% reading + 5 digits)
	10A	0.01A	
AC Current (A AC) (50/60Hz)	200μA	0.1μA	±(1.5% reading + 5 digits)
	2000μA	1μA	±(1.8% reading + 5 digits)
	20mA	0.01mA	
	200mA	0.1mA	

	2A	0.001A	±(3.0% reading + 7 digits)
	10A	0.01A	
Resistance	200Ω	0.1Ω	±(1.2% reading + 4 digits)
	2kΩ	1Ω	±(1.2% reading + 2 digits)
	20kΩ	0.01kΩ	
	200kΩ	0.1kΩ	
	2MΩ	0.001MΩ	
	20MΩ	0.01MΩ	±(2.0% reading + 3 digits)

Notes:

Accuracy specifications consist of two elements:

- (% reading) – This is the accuracy of the measurement circuit.
- (+ digits) – This is the accuracy of the analog to digital converter.

Accuracy is stated at 65°F to 83°F (18°C to 28°C) and less than 75% RH.

Diode Test

Test current of 0.3mA maximum,
open circuit voltage 1.5V DC typical

Continuity Check

Audible signal will sound if the
resistance is less than 100Ω

Input Impedance

10MΩ (VDC & VAC)

AC Bandwidth

50 / 60Hz

Display

2000 count (0 to 1999) backlit LCD

Over-range indication

“OL” is displayed

Auto Power Off

After 15 minutes (approximately) of
inactivity


Polarity

Automatic (no indication for
positive); Minus (-) sign for negative

Measurement Rate

2 times per second, nominal

Low Battery Indication

“” is displayed if battery voltage
drops below operating voltage

Battery

Two (2) 1.5V ‘AAA’ batteries

Fuses	mA, μ A ranges; 200mA/250V fast blow A range; 10A/250V fast blow
Operating Temperature	32°F to 122°F (0°C to 50°C)
Storage Temperature	-4°F to 140°F (-20°C to 60°C)
Operating Humidity	Max 70% up to 87°F (31°C) decreasing linearly to 50% at 122°F (50°C)
Storage Humidity	<80% RH
Operating Altitude	7000ft. (2000meters) maximum.
Weight	9.17 oz (260g) (includes holster).
Size	5.8" x 2.9" x 1.6" (147 x 76 x 42mm) (includes holster)
Safety	This meter is intended for indoor use and protected, against the users, by double insulation per EN61010-1 and IEC61010-1 2nd Edition (2001) to CAT II 1000V & CAT III 600V; Pollution Degree 2. The meter also meets UL 61010-1, Second Edition (2004), CAN/CSA C22.2 No. 61010-1, Second Edition (2004), and UL 61010B-2-031, First Edition (2003)
Approvals	CE, UL

PER IEC1010 OVERVOLTAGE INSTALLATION CATEGORY

OVERVOLTAGE CATEGORY I

Equipment of OVERVOLTAGE CATEGORY I is equipment for connection to circuits in which measures are taken to limit the transient overvoltages to an appropriate low level. Note – Examples include protected electronic circuits.

OVERVOLTAGE CATEGORY II

Equipment of OVERVOLTAGE CATEGORY II is energy-consuming equipment to be supplied from the fixed installation. Note – Examples include household, office, and laboratory appliances.

OVERVOLTAGE CATEGORY III

Equipment of OVERVOLTAGE CATEGORY III is equipment in fixed installations.

Note – Examples include switches in the fixed installation and some equipment for industrial use with permanent connection to the fixed installation.

OVERVOLTAGE CATEGORY IV

Equipment of OVERVOLTAGE CATEGORY IV is for use at the origin of the installation.

Note – Examples include electricity meters and primary over-current protection equipment

UL LISTED

The UL mark does not indicate that this product has been evaluated for its accuracy.

BATTERY INSTALLATION

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery cover.

1. Disconnect the test leads from the meter.
2. Remove the rear battery cover by removing the two screws using a Phillips head screwdriver.
3. Insert the battery into battery clips, observing the correct polarity.
4. Put the battery cover back in place and secure with the two screws.

WARNING: To avoid electric shock, do not operate the meter until the battery cover is in place and fastened securely.

NOTE: If your meter does not work properly, check the fuses and batteries to make sure that they are still good and that they are properly inserted.

OPERATING INSTRUCTIONS

WARNING: Risk of electrocution. High-voltage circuits, both AC and DC, are very dangerous and should be measured with great care.

1. ALWAYS turn the function switch to the OFF position when the meter is not in use.
2. Press the HOLD button to freeze a displayed reading

NOTE: On some low AC and DC voltage ranges, with the test leads not connected to a device, the display may show a random, changing reading. This is normal and is caused by the high-input sensitivity. The reading will stabilize and give a proper measurement when connected to a circuit.

NON-CONTACT AC VOLTAGE DETECTOR

The EX320 can detect the presence of AC voltage (from 100 to 600VAC) simply by being held very near to a voltage source.


WARNING: Test the AC voltage detector on a known live circuit before each use.

WARNING: Before using the meter in the AC Voltage Detector mode, verify that the battery is fresh by confirming characters appear on the LCD when the function dial is turned to any position. Do not attempt to use the meter as an AC Voltage Detector if the battery is weak or bad.

NON-CONTACT VOLTAGE (NCV)

The NCV function works on any rotary switch position.

1. Test the detector on a known live circuit before use.
2. Press and hold the NCV button for the duration of the test. The meter will beep once when the button is pushed.
3. Hold the top of the meter very close to the voltage source as shown.
4. If voltage is present, the rim of the LCD display will flash a bright orange and an audible warning will sound.

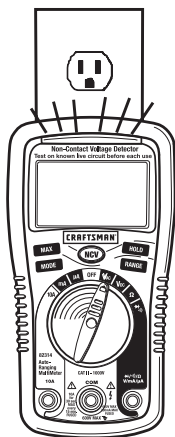


AC VOLTAGE MEASUREMENTS

WARNING: Risk of Electrocutation. The probe tips may not be long enough to contact the live parts inside some 240V outlets for appliances because the contacts are recessed deep in the outlets. As a result, the reading may show 0 volts when the outlet actually has voltage on it. Make sure the probe tips are touching the metal contacts inside the outlet before assuming that no voltage is present.

CAUTION: Do not measure AC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


1. Set the function switch to the VAC position.
2. Insert the black test lead banana plug into the negative COM jack. Insert the red test lead banana plug into the positive V jack.
3. Touch the black test probe tip to the neutral side of the circuit.
4. Touch the red test probe tip to the "hot" side of circuit.
5. Read the voltage in the display.

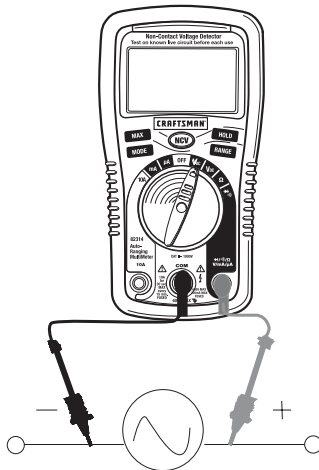

DC VOLTAGE MEASUREMENTS

CAUTION: Do not measure DC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


1. Set the function switch to the VDC position.
2. Insert the black test lead banana plug into the negative COM jack. Insert the red test lead banana plug into the positive V jack.
3. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
4. Read the voltage in the display.

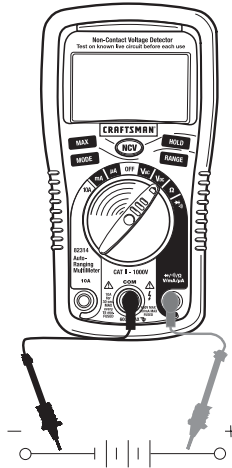

AC / DC CURRENT MEASUREMENTS

CAUTION: Do not make current measurements at 10 Amps for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


1. Insert the black test lead banana plug into the negative COM jack.
2. For current measurements up to $2000\mu\text{A}$, set the function switch to the μA position and insert the red test lead banana plug into the mA/ μA jack
3. For current measurements up to 200mA , set the function switch to the mA position and insert the red test lead banana plug into the mA/ μA jack.
4. For current measurements up to 10A , set the function switch to the 10A range and insert the red test lead banana plug into the 10A jack.
5. Use the MODE button to select AC or DC current.
6. Remove power from the circuit under test, then open up the circuit at the point where you wish to measure current.
7. Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
8. Apply power to the circuit.
9. Read the current in the display.

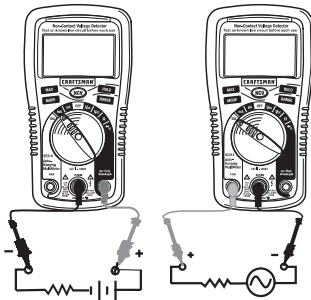

RESISTANCE MEASUREMENTS



WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.


1. Set the function switch to the Ω position.
2. Insert the black test lead banana plug into the negative COM jack. Insert the red test lead banana plug into the positive Ω jack.
3. Touch the test probe tips across the circuit or component under test. It is best to disconnect one side of the circuit under test so the rest of the circuit will not interfere with the resistance reading.
4. Read the resistance in the display.

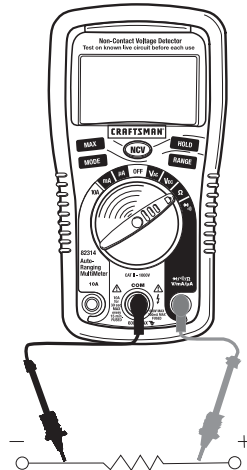




CONTINUITY CHECK

 
WARNING: To avoid electric shock, never measure continuity on circuits or wires that have voltage on them.

1. Set the function switch to the  position.
2. Insert the black lead banana plug into the negative COM jack.
3. Insert the red test lead banana plug into the positive  jack.
4. Use the MODE button to view the icon on the display.
5. Touch the test probe tips to the circuit or wire under test.
6. If the resistance is less than approximately 100Ω , the audible signal will sound. If the circuit is 'open' (bad), the display will indicate "OL".

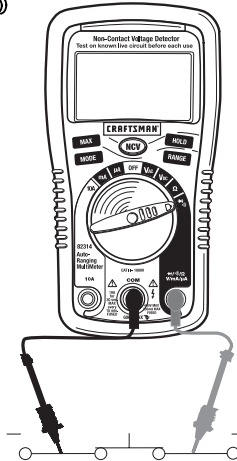

DIODE TEST

   1. Set the function switch to the  position.
2. Insert the black test lead banana plug into the negative **COM** jack and the red test lead banana plug into the positive  jack.
3. Use the MODE button to view the  icon on the display.
4. Touch the test probes to the diode under test. Forward voltage will typically indicate 0.400 to 0.700V. Reverse voltage will indicate "OL". Shorted devices will indicate near 0V and an open device will indicate "OL" in both polarities.

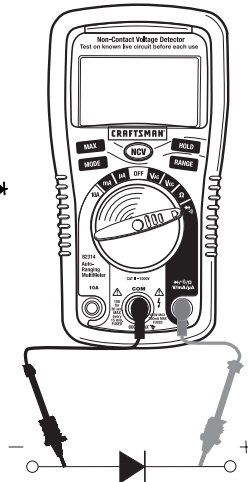

AUTO-MANUAL RANGE SELECTION

When the meter is first turned on, it automatically goes into the Auto Range mode. This automatically selects the best range for the measurements being made and is generally the best mode for most measurements. For measurement situations requiring that a range be manually selected, perform the following:

1. Press the RANGE key. The **AUTO** display indicator will turn off.
2. Press RANGE to step through the available ranges until the desired range is selected.
3. To exit the Manual Ranging mode and return to Auto Range mode, press and hold the RANGE key for 2 seconds.

Note: When in the autoranging mode the meter will up-range to the next higher range when the measured value is above 90% of full scale. This guard band prevents autorange oscillation. If maximum counts are required in this band, use manual ranging.

MAX MODE

Press the MAX button (the MAX icon will appear on the LCD). The meter will now only display the highest reading during a test. Each time a higher reading is encountered, the display will update. Press the MAX button again to exit this mode.

AUTO POWER OFF

The meter will automatically turn off after 15 minutes of inactivity. This will conserve battery energy. To turn the meter on after an Auto Power OFF, simply turn the rotary switch to OFF and then back to the desired setting.

MAINTENANCE

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the back cover or the battery or fuse covers.

WARNING: To avoid electric shock, do not operate your meter until the battery and fuse covers are in place and fastened securely.


This MultiMeter is designed to provide years of dependable service, if the following care instructions are performed:

1. **KEEP THE METER DRY.** If it gets wet, dry it immediately.
2. **USE AND STORE THE METER IN NORMAL TEMPERATURES.** Temperature extremes can shorten the life of the electronic parts and distort or melt plastic parts.
3. **HANDLE THE METER GENTLY AND CAREFULLY.** Dropping it can damage the electronic parts or the case.
4. **KEEP THE METER CLEAN.** Wipe the case occasionally with a damp cloth. DO NOT use chemicals, cleaning solvents, or detergents.
5. **USE ONLY FRESH BATTERIES OF THE RECOMMENDED SIZE AND TYPE.** Remove old or weak batteries so they do not leak and damage the unit.
6. **IF THE METER IS TO BE STORED FOR A LONG PERIOD OF TIME,** the battery should be removed to prevent damage to the unit.

LOW BATTERY INDICATION

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery cover.

LOW BATTERY INDICATION


The  icon will appear in the lower left-hand corner of the display when the battery voltage becomes low. Replace the batteries when this appears.

BATTERY REPLACEMENT

1. Disconnect the test leads from the meter.
2. Remove the protective rubber holster as shown in the diagram.
3. Remove the Phillips head screw located on the lower back of the instrument.
4. Flip up the fuse/battery compartment cover to access the batteries.
5. Gently remove the batteries and install two new 1.5V 'AAA' batteries observing polarity.
6. Secure the fuse/battery compartment cover.
7. Place the protective rubber holster on the meter.

WARNING: To avoid electric shock, do not operate the meter until the batteries and the fuses are in place and fastened securely.

1. Removable Rubber Holster
2. Meter
3. Battery
4. Fuses
5. Compartment Cover
6. Rubber Holster

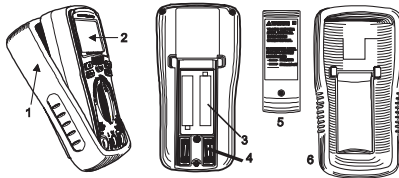


WARNING: To avoid electric shock, do not operate the meter until the battery is in place and fastened securely.

REPLACING THE FUSES

WARNING: To avoid electric shock, disconnect the test leads from the meter before removing the fuse cover.

1. Disconnect the test leads from the meter.
2. Remove the protective rubber holster as shown in the diagram.
3. Remove the Phillips head screw located on the lower back of the instrument.
4. Flip up the fuse/battery compartment cover to access the fuses.
5. Gently remove the fuse(s) and install new fuse(s) into the holder(s).
6. Always use fuses of the proper size and value (200mA/250V fast blow for the mA / μ A ranges, 10A/250V fast blow for the A range).
7. Secure the fuse/battery compartment cover.
8. Place the protective rubber holster on the meter.

1. Removable Rubber Holster
2. Meter
3. Battery
4. Fuses
5. Compartment Cover
6. Rubber Holster

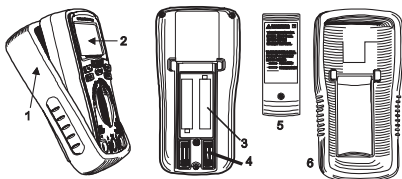

WARNING: To avoid electric shock, do not operate your meter until the fuse cover is in place and fastened securely.

TROUBLESHOOTING

There may be times when your meter does not operate properly. Here are some common problems that you may have and some easy solutions to them.

Meter Does Not Operate:

1. Always read all the instructions in this manual before use.
2. Check to be sure the battery is properly installed.
3. Check to be sure the battery is good.
4. If the battery is good and the meter still doesn't operate, check to be sure that both ends of the fuse are properly installed.

If You Do Not Understand How the Meter Works:

1. Purchase "Multitesters and Their Use for Electrical Testing", (Item No. 82303).
2. Call our Customer Service Line **1-888-326-1006**.

SERVICE AND PARTS

Item Number	Description
82374	Fuse kit
93894	9V battery
82378	Set of black and red Test Leads
82314-D	Replacement battery cover
82314-C	Front Cover
82314-CS	Rear cover screws
82377	Thermocouple probe

For replacement parts shipped directly to your home
Call 9 am – 5 pm Eastern Time, M - F
1-888-326-1006